



ANNEALING GUIDE FOR PLASTIC

48⁺ Years
Of experience



In Association with SVCH-Technologii, Moscow (Russia)

ISO 9001:2015 | ISO 14001:2015 | ISO 45001:2018

ABOUT US

KERONE is now renowned for serving the specialized needs of customers with the best quality and economical process of application engineering solutions and industrial heating products manufactured in a high-quality environment by a trained and qualified workforce (special purpose machinery)



KERONE is a pioneer in application and implementation engineering with its vast experience and team of professionals.



KERONE is devoted to serve the industry to optimize its operations both economically and environmentally with its specialized process engineering solutions.



KERONE is having immense expertise in manufacturing and implementing various types of engineering solutions.



KERONE is possessing employee strength of more than 280+ experts continuously putting efforts for happy industrial engineering solutions



48+ Years Manufacturing Excellence



Great Sale Support



Highly Customized Product



Adherence to Standards



Sound Infrastructure



Team of experts Delivering Quality



Timely Delivery



Cost Effective Solutions



WHY CHOOSE US

"Choose Kerone for innovative solutions tailored to your unique product needs, ensuring efficiency, reliability, and unmatched quality."

With decades of expertise, cutting-edge technology, and a customer-centric approach, Kerone Engineering offers tailor-made Applications Engineering solutions that prioritize quality, flexibility, and cost-effectiveness. Benefit from our commitment to excellence, post-sales support, and innovative solutions for your unique Applications Engineering needs. Choose Kerone Engineering for reliability, performance, and unmatched value.

MISSION



To enhance the value of customer operation through our customer need centric engineering solution.



We are committed to providing our customers with unique and best-in-class products in the industrial thermal processing segments. Through strategic tie-ups for technical know-how with renowned leaders in industry-specific segments, we ensure that our offerings meet the highest standards of quality and innovation.

VISION



Turn into a world leader in providing specialized, top-notch quality and ecological industrial heating, cooling, and drying solutions across the globe.



To attain global recognition as the best of quality and environment-friendly engineering solution company.



Enhance the value of customer operation through our customer need centric engineering solution.



TRUSTED PARTNERS





Definition

The annealing of plastics could be a secondary processing procedure putting components within the correct medium beneath a particular temperature between the melting temperature (T_m) and the glass transition temperature (T_g), then maintaining the temperature for a time before slowly cooling plastics down. The mediums for heating include: liquid (water, oil, ethylene glycol, etc.) or air.

The condition of plastics annealing depends on the processing method (injection, extrusion, etc.), and proper conditions have to be tailored to the purpose.

Effect

Improves dimensional stability through acceleration of post-molding shrinkage.

Crystalline plastics such as POM, PA, and PBT have huge volume changes when they solidify due to their regular molecular orientation.

Crystalline plastics are divided into either crystalline and amorphous types, and volume reduction occurs when amorphous areas become crystalline under high using temperature. This phenomenon is called post-molding shrinkage.

The level of post-molding shrinkage depends on the processing condition like mold temperature, injection temperature, or even the thickness of the parts.

1 Methods to increase dimensional stability

- Maintaining high mold temperature during injection

High mold temperature can accelerate crystallization so that post-molding shrinkage can be minimized. Generally, if mold temperature is higher than normal-use temperature, annealing is usually unnecessary.

- Annealing

This method is to expose the part to high temperature conditions over a certain period to accelerate crystallization before use. As a result, further shrinkage during the usage period cannot occur.

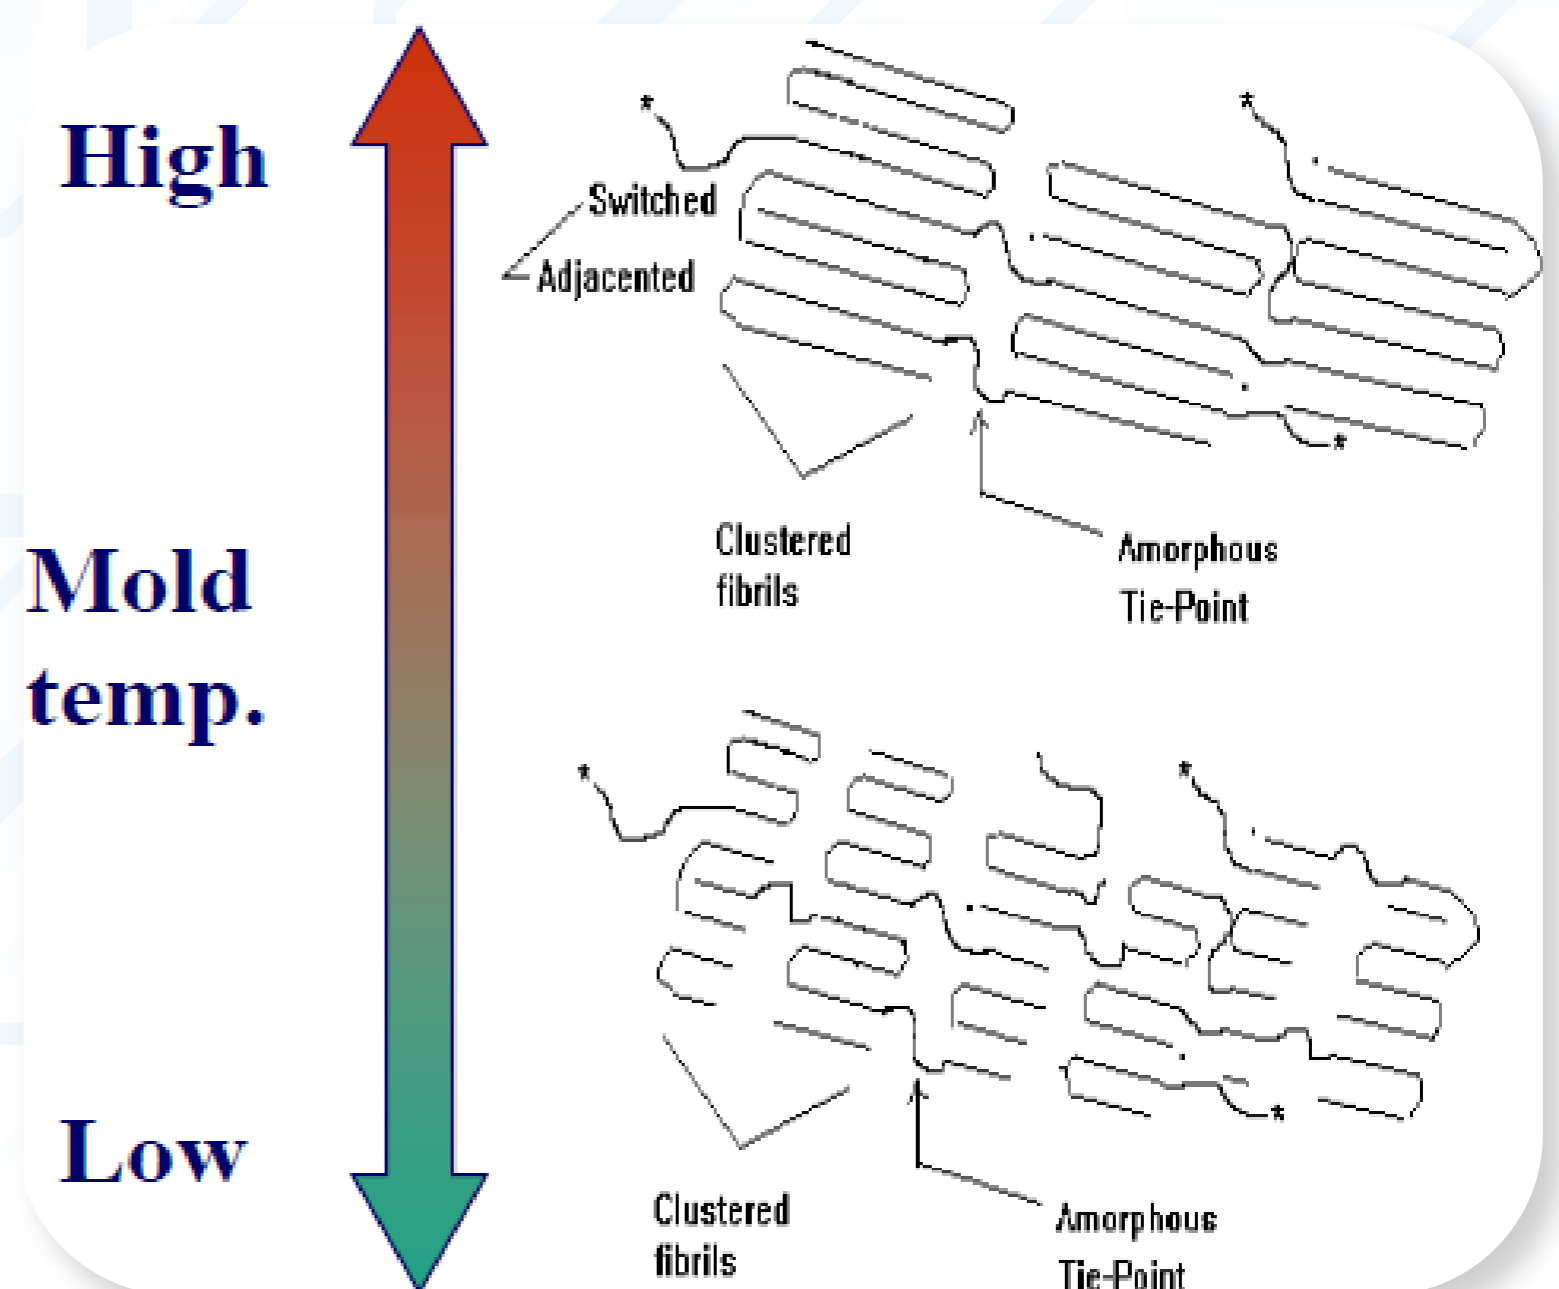


Fig. 1 Crystal structure based on mold temperature

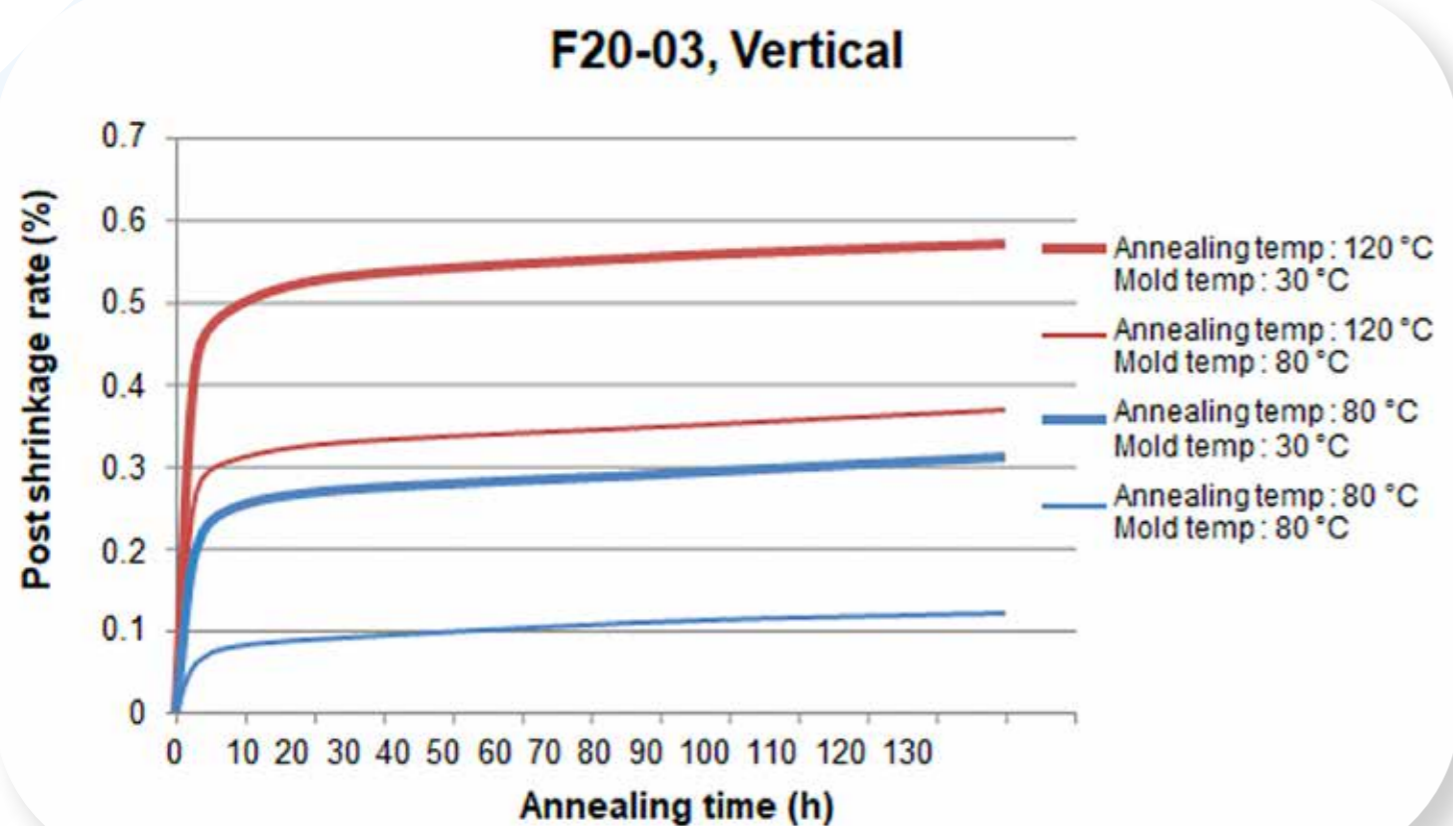
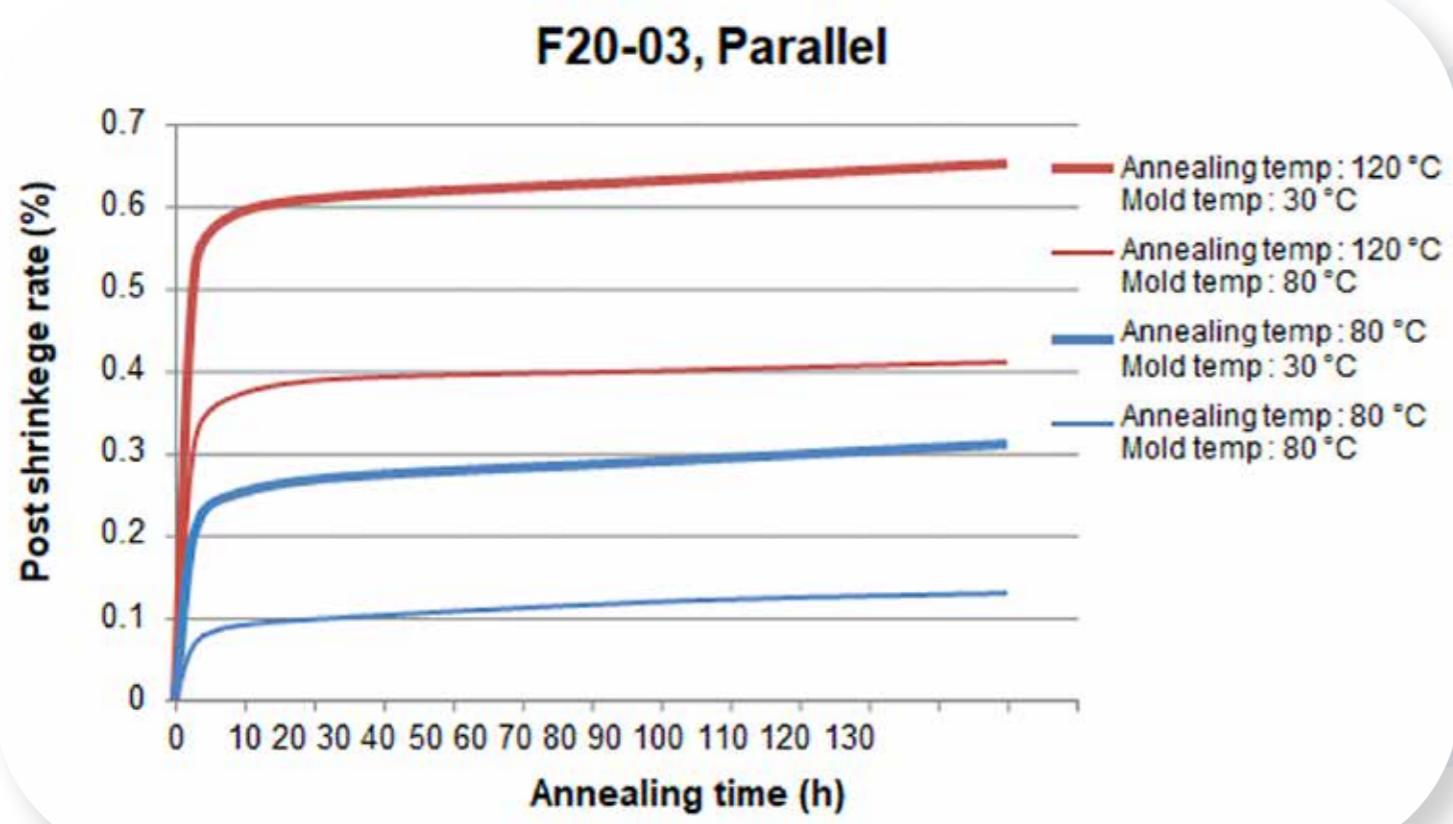


Fig. 2 Variation of post-molding shrinkage rate due to annealing time [KERONE F20-03, t = 2mm]

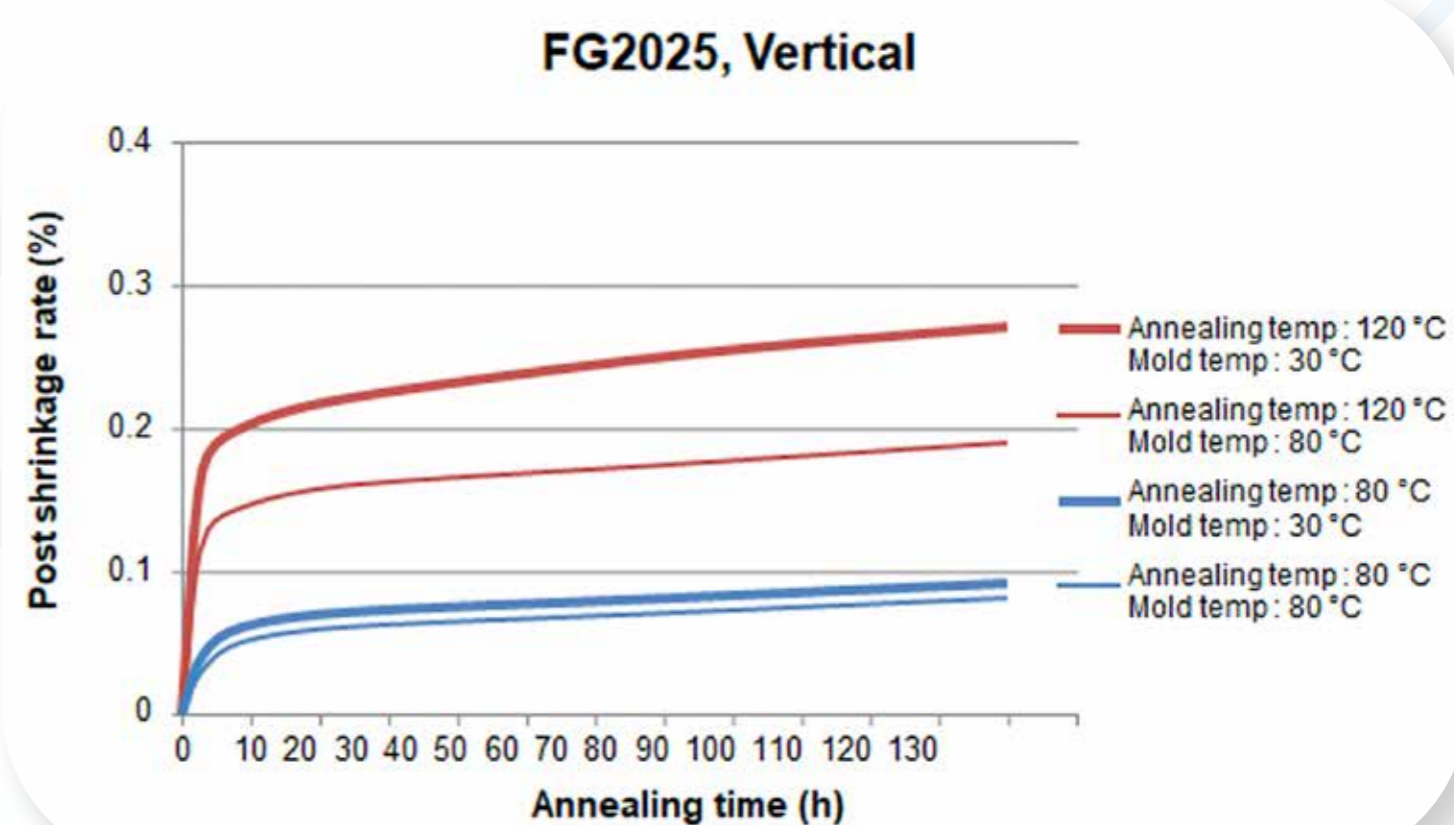


Fig. 3 Variation of post-molding shrinkage rate due to annealing time [KERONE FG2025(G/F 25% reinforced, t = 2mm)]

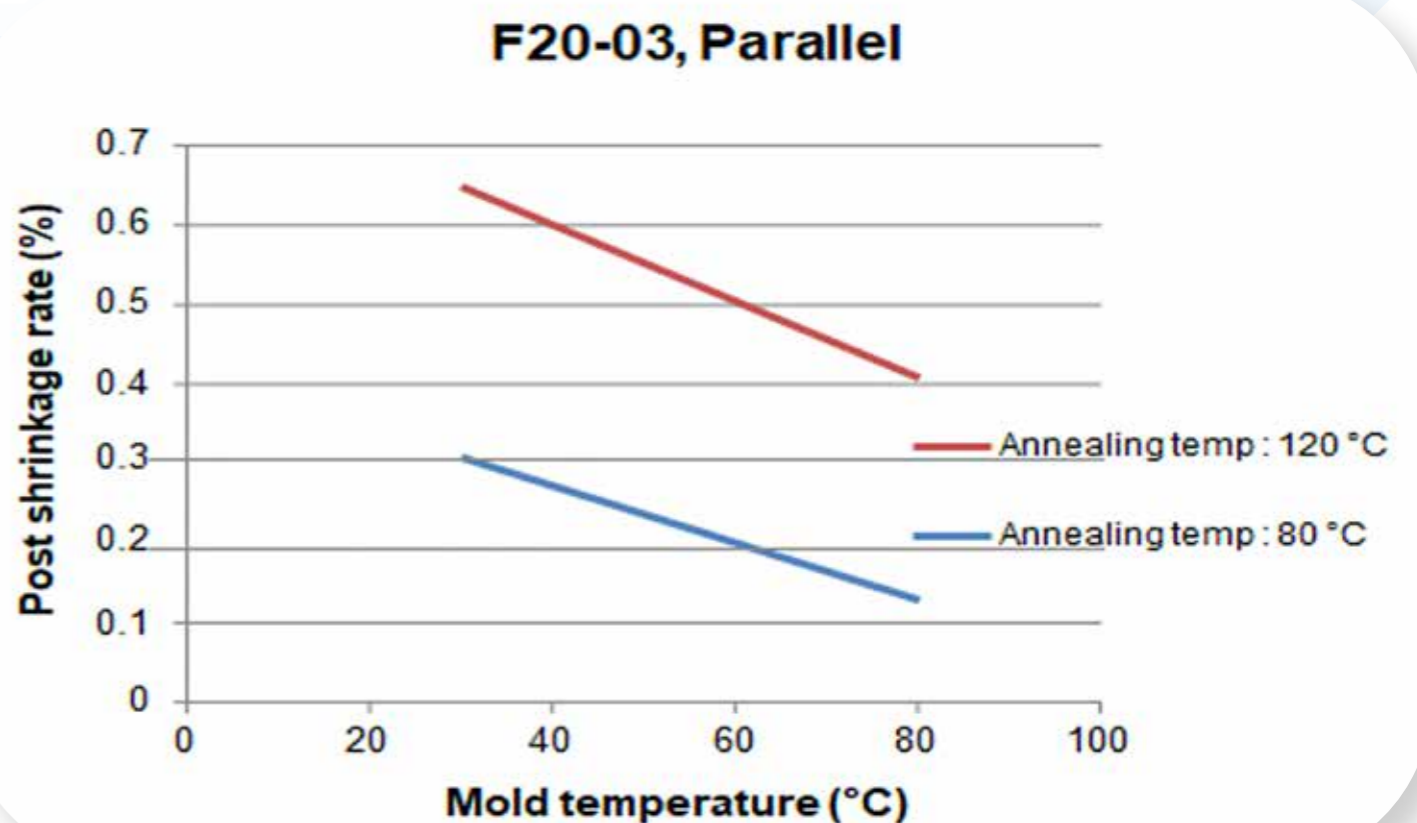


Fig. 4 Variation of post-molding shrinkage rate due to mold temperature [F20-03, t = 2mm]

2 Improve crack resistance [Relaxing parts' internal stress]

During the injection or extrusion method, components can incur residual stress. Stress happens because of molecular orientation in the flow direction once the melted resin is flowing into the mould cavity or sizing die for extrusion, additionally to the shrinkage, density, and distinction of crystallinity originating from uneven cooling conditions because of the partially completely different temperatures and the distinction of cooling speed between surface and internal components (surface cooling speed is faster) throughout the cooling of the resin.

Beyond that, post processing (cutting, drilling, sewing, etc.), welding, and adhesion points can incur this type of stress. As this restricts, performance of their own properties, cracks, fractures, and bending at the point of stress can easily occur. Of course, while it would reduce naturally after a while, it takes a relatively long time, so artificially adding homogeneous heat to the entire part can shorten the process.

3 Improvement for mechanical properties

Generally plastic annealing can cause increases of density, tensile strength, flexural strength, and glass transition temperature of parts, while decreasing impact strength, elongation because of the change for plastic crystal structure, and crystallization.

4 Improvement for heat resistance

Potential exists to improve heat resistance due to the increase of crystallization during annealing.



5

Process mechanism

In theory, annealing temperature has to be higher than the plastic's glass transition temperature (T_g), and the stress relaxation rapidly proceeds at this temperature.

However, this temperature also can cause bending and torsion, and as such annealing must be performed quickly within the maximum limit of dimensional change based on the stress relaxation.


At this time, the best annealing temperature depends on the thickness, shape, volume, history of heat processing, and geometry of parts; this can be decided experimentally.

It's recommended to set the annealing temperature to $5\text{ }^\circ\text{C}$ lower than the temperature that causes the part's allowable range of maximum deformation to be reached, tested by putting part in a hot air oven or bath and raising the temperature at intervals of $3\sim 5\text{ }^\circ\text{C}$. As this is difficult to apply realistically, Polyamide is recommended to be set to an annealing temperature around $80\text{ }^\circ\text{C}$. Below this, there would be no annealing effect, while above this, water can evaporate and also runs the risk of increasing the temperature too high, and as such, the proper temperature would be $80\text{ }^\circ\text{C}$.

The necessary time for annealing is chosen by the part's thickness, shape, annealing medium, and is usually recommended to be chosen by testing. Cooling speed depends on the thick-temperature between external and internal components.

Normally, if a part's thickness is thin, the cooling speed must fast and vice versa.

However, keep in mind that if the cooling speed is too fast or slow, a different cooling speed between the inside and outside can cause other residual stressness, and should be kept at a homogenized cooling

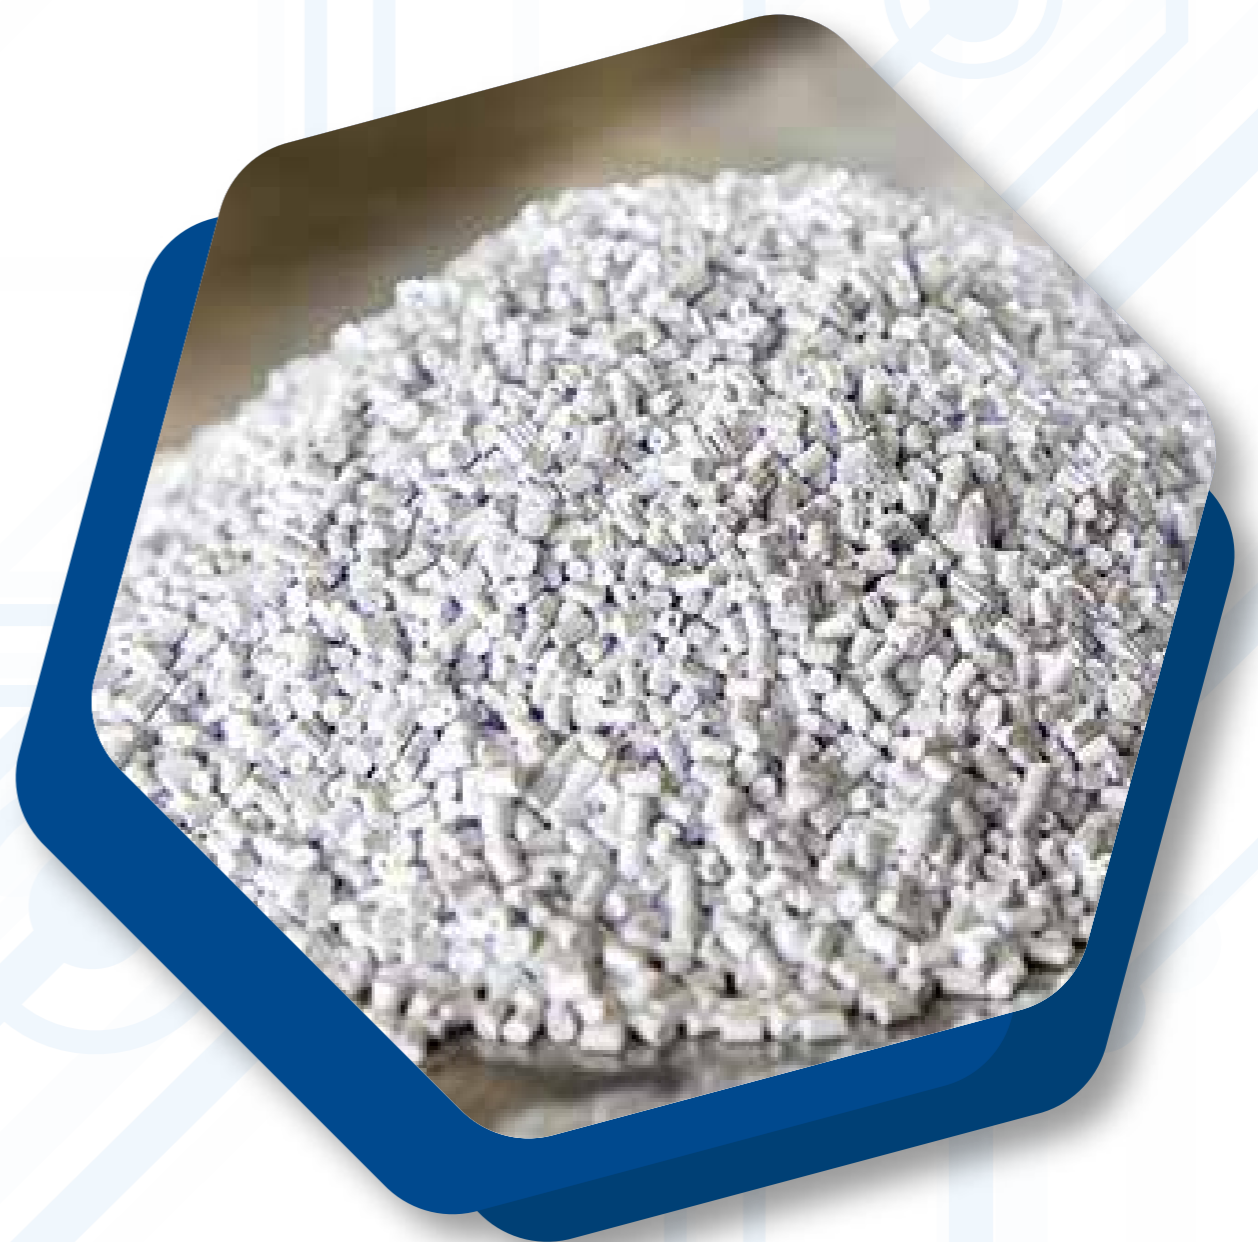

6

Annealing medium

Annealing medium is also a factor of the annealing effect. Liquid is faster than air to deliver heat, so the process can be completed shortly.

However, it is influenced by the liquid's heat properties and so must be considered.

Hot air is used widely but nylon must be treated with liquid to avoid oxidation. Water is the best annealing medium, but the boiling point is too low so it is used together with surfactant for the purpose to increase both the boiling temperature and water absorption on the surface of the part.

Particularly in the case of nylon resin, injection parts are often to be treated with water at the $70\sim 90\text{ }^\circ\text{C}$ range for $20\sim 40$ minutes. This can prevent any property or dimensional variation by moisture absorption, while also increasing the mechanical properties like the part's strength and toughness by the annealing effect.

7 Annealing method for injection parts

Injection parts' annealing temperature must be adjusted according to the usage temperature condition.

Generally, it is set to 10 ~ 20°C higher than usage temperature.

That is, if a part's usage temperature is 80°C, the proper annealing temperature is generally 90 ~ 100°C. 20°C above usage temperature is also allowable, but if the temperature is too high, it can incur problems like discoloration, so this needs special attention.

Although the general recommended annealing time for injection parts would be around 3 hours, parts which are thick and injected under high mold temperature can be annealed faster. The best method is to find the proper time through testing.

8 Annealing method for extrusion parts

Thick extrusion parts as like rods and plates have different annealing conditions compared to injection parts. This is caused by large heat and time loss toward the center of the rod or plate. Generally rods and plates have to undergo a relatively higher and longer annealing process than injection parts.

1. Oil annealing

- Usage equipment : Electric heating bath

2. Usage oil

- Acetal resin : Purified paraffin annealing oil
- Nylon resin
 - 1 Hydrocarbon oil or waxes
 - 2 High melting point inert mineral oil

3. Annealing method (Rod annealing condition of acetal copolymer)

- Oil preheated to 80°C
- Put the extrusion part into the bath
- Increased heat to 145 ~ 150°C
- Maintain the fixed time 145°C or up to 150°C
- Slowly cool the bath to 80°C
- Remove the extrusion part
- Wash the part with trichloroethylene

4. Annealing time :

Depends on the thickness or diameter of the extrusion part.

5. Air annealing

- Usage equipment : Air circulation oven (Better to fill with nitrogen)
- Applied resin
 - 1 Air annealing method can cause discoloration and as such is not recommended for nylon resin.
 - 2 Air annealing method is normally recommended for PE, PP, and POM (acetal resin).

6. Annealing method

[Table 1] Rod annealing condition of acetal copolymer

Division	Temperature	Duration (Diameter below 100mm)	Duration (Large diameter)
Heating the loaded oven	Room Temperature -> 145°C	3 h 20 min	24 h
Annealing	145	1000 min (16 h 40min)	48~72 h
Cooling the oven to 40 ~ 50°C	145°C-> Room temperature	6 h	36 h
Total		26 h	108 ~ 132 h

9 Precautions

Annealing is not always necessary. Occasionally, unnecessary annealing may create dimensional issues originating from a higher shrinkage rate. In addition, annealing is not always the solution to stress.

To obtain a quality product, accurate design, proper material selection and processing technique are necessary, and through this, reduction of processing errors. It is recommended to avoid annealing as post-processing, whenever possible.

Precautions of G/F-reinforced products' anisotropy

Glass reinforced products can incur anisotropy. This is influenced by the part's thickness, location of gate, and shape.


Do not anneal products with metal inserts

The stress in products with metal inserts forces plastics near the insert to incur too much stress under long periods of real usage temperatures, and at the same time, the size of the product is also decreased, risking cracks (especially near weld-line) around the insert.

Precaution of excessive annealing

Basically, excessive annealing will cause issues like discoloration, decomposition, surface blistering, and different undesirable problems. To this end, it's suggested to find the annealing condition established on measuring the real part's dimensions.

OUR CLIENTS

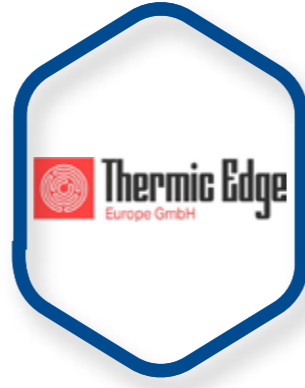







THANK YOU

UNIT 1

4 & 5, Marudhar Industrial Estate, Gas Godown Lane, Goddev Fatak Road, Bhayander (E), Dist. Thane - 401105. (India)

Contact Us
+91-22 48255071,
48255072

UNIT 2

Plot No. B-47, Addl. Midc Anandnagar, Ambernath (E), Dist. Thane (India)- 421506

Contact Us
+91(0251)26205
42/43/44/45/46

KRDC

Plot No K2, Industrial Gala F4A, D- Wing, MGN Properties, Opposite Godrej Co., Addl MIDC Anand Nagar, Ambernath (E)- 421506 (India)

Contact Us
+91-2512620543/44

UNIT 4 (EUROPE)

Kerone Engineering Solutions LTD. (EMitech) Viale della Palma, 7, 70033 Corato BA, Italy (Europe)

UNIT 5 (THAILAND)

Thailand Representative:
163 Rajapark Building,
18th floor, Sukhumvit 21
Road (Asoke), Wattana,
Bangkok - 10110, Thailand

Contact Person
G.Vivekanand
+6689 500 9821

Uzbekistan / Kazakhstan (Office)

TIT Company LLC: 100060,
2, A. Kahhar, Tashkent,
Uzbekistan

Contact Person
Mr. Slava
+998 903540963

Israel (Office)

Ornatus Industrial Tech
Ltd: Dam Hamac bim 36,
7178602 Modiin, Israel

Contact Person
Omri Fabian
+972 584844887

Australia & New Zealand (Office)

Linotech Pty Ltd:
Po Box 3046, Browns
Plains, Qld 4118. Australia

Contact Person
Eric Quevauvilliers
+61 (0)418 871 005

Bangladesh (Office)

House-10, Road-5 Priyanka
City, Sector-12, Uttara,
Dhaka-1230, Bangladesh

Contact Person
Md. Emtiaz Morshed
+8801747762200



SCAN HERE

Our Mails

info@kerone.com
sales@kerone.com
marketing@kerone.com

Website

www.kerone.com
www.kerone.net
www.keroneindia.com